


INSTRUCTION SHEET

CID-1 CUSTOMER INTERFACE DEVICE

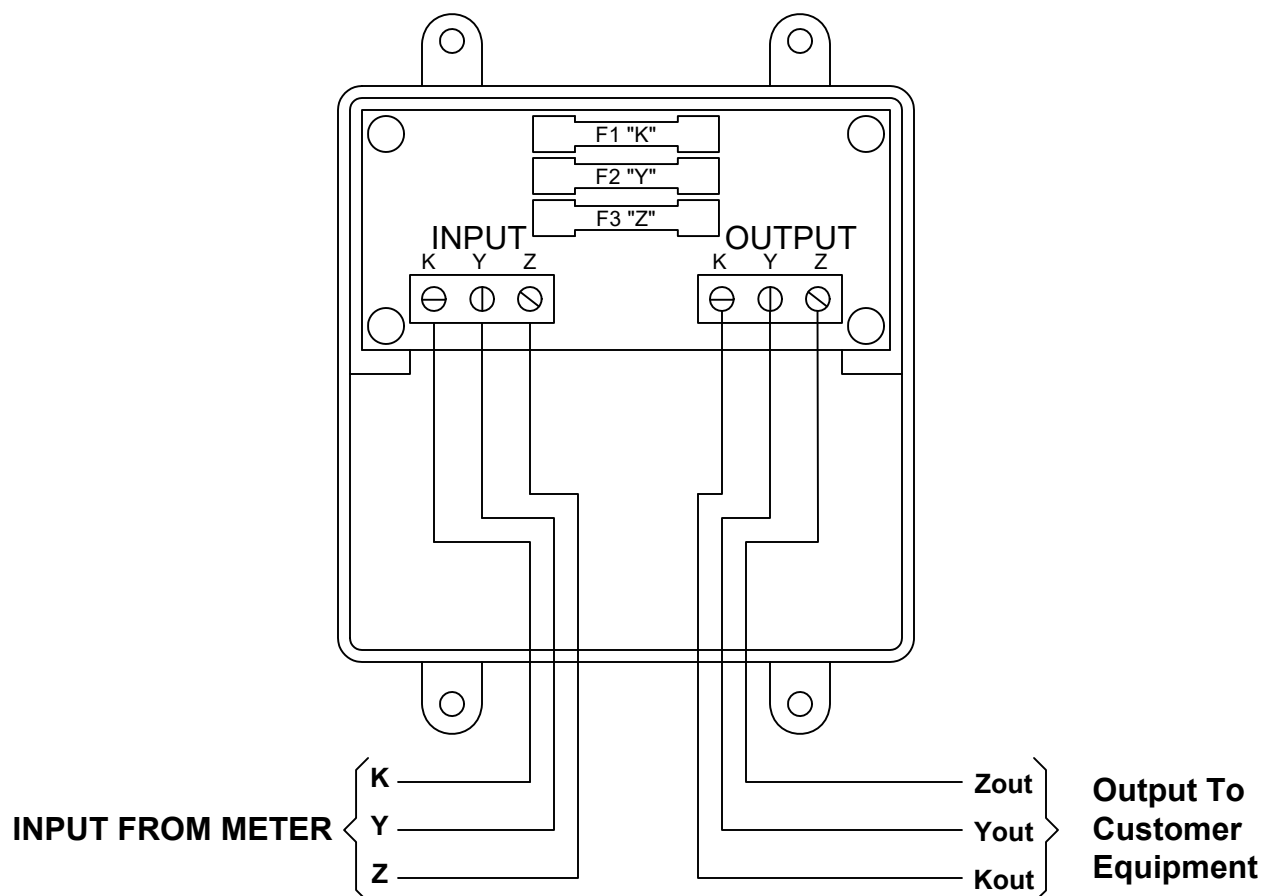


MOUNTING POSITION - The CID-1 can be mounted in any position.

POWER INPUT - None. The CID-1 is a wire termination device with fuses between the inputs and outputs and arc suppression across the contacts. Power is supplied to and from (through) the device by an external source.

METER CONNECTIONS - The CID-1's "K", "Y" and "Z" input terminals should be connected to the meter's "K", "Y" and "Z" terminals: "K" to "K", "Y" to "Y", and "Z" to "Z".

FUSES - The fuses are type 3AG and may be up to 2 Amps in size. Three 1/2 Amp fuses are supplied standard with the unit.

OUTPUT - The output is configured as a 3-wire output, however K&Y or K&Z may be used in the 2-wire mode depending on the wiring of the CID-1 from the meter. Arc suppression is provided internally by a RC "snubber" network. While the snubber network may help limit arcing on the contacts of the KYZ switch, it is not intended to provide isolation between the meter and customer's equipment such as that provided by an isolation relay.

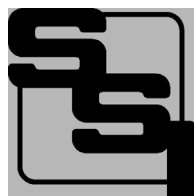

SOLID STATE INSTRUMENTS

by Radian Research, Inc

3852 Fortune Dr, Lafayette, IN 47905

Phone: (765) 449-5576

Mail: technicalsupport@radianresearch.com